


Low energy SWRO

TM800V

Diameter Inch	Membrane Area ft²(m²)	Salt Rejection %	Product Flow Rate gpd(m³ / d)	Feed Spacer Thickness mil
4"	87(8)	99.8	1,900(7.2)	28
8"	400(37)	99.8	9,000(34.1)	34
8"	440(41)	99.8	9,900(37.5)	28
	4" 8"	Inch ft ² (m ²) 4" 87(8) 8" 400(37)	Inch ft ² (m ²) % 4" 87(8) 99.8 8" 400(37) 99.8	Inch ft²(m²) % gpd(m³ / d) 4" 87(8) 99.8 1,900(7.2) 8" 400(37) 99.8 9,000(34.1)

1. Membrane Type		Cross Linked Fully Aromatic Polyamide Composite
2. Test Conditions		
	Feed Water Pressure	800 psi(5.52MPa)
	Feed Water Temperature	77° F(25°C)
	Feed Water Concentration	32,000 mg/l NaCl
	Recovery Rate	8%
	Feed Water pH	7
3. Minimum Salt Rejection		99.5%
4. Minimum Product Flow Rate		1,550gpd(5.9m ³ /d)(TM810V)
		7,500gpd(28.4m ³ /d)(TM820V-400)
		8,250gpd(31.2m ³ /d)(TM820V-440)
5. Boron Rejection		92% at pH 8 (5mg/l Boron added to Feed water)
(typical value)		COUNTY SERVICE AND ADDRESS OF THE SERVICE AND AD

Dimensions

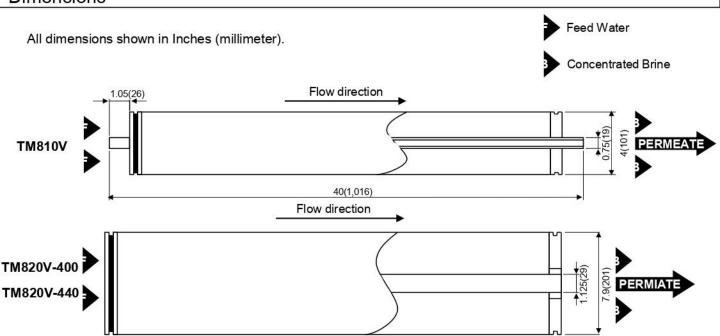

40(1,016)

Operating Limits

Maximum Operating Pressure —	1200psi (8.3 MPa)
Maximum Feed Water Temperature —	113° F (45°C)
Maximum Feed Water SDI15 —	5
Feed Water Chlorine Concentration —	— Not detectable
Feed Water pH Range, Continuous Operation	2-11
Feed Water pH Range, Chemical Cleaning ————	1-12
Maximum Pressure Drop per Element —	15 psi (0.10 MPa)
Maximum Pressure Drop per Vessel ——————————————————————————————————	50 psi (0.34 MPa)

Operating Information

- 1.For the recommended design range, please consult the latest Toray technical bulletin, design guidelines,computer design program, and/ or call an application specialist. If the operating limits given in this Product Information Bulletin are not strictly followed, the Limited Warranty will be null and void.
- 2. All elements are wet tested, treated with tested feed water solution, and then vacuum packed in oxygen barrier bags with deoxidant inside. To prevent biological growth during system shutdown, it is recommended to perform 30-60 minutes flushing of Toray elements with seawater once in every two days.
- 3.The presence of free chlorine and other oxidizing agents under certain conditions, such as heavy metals which acts as oxidation catalyst in the feed water will cause unexpected oxidation of the membrane. It is strongly recommended to remove these oxidizing agents contained in feed water before operating RO system.
- 4. Permeate from the first hour of operation shall be discarded.
- 5. The customer is fully responsible for the effects of chemicals that are incompatible with the elements. Their use will void the element Limited Warranty.

Notice

- Toray accepts no responsibility for results obtained by the application of this information or the safety or suitability of Toray's products, either alone or in combination with other products. Users are advised to make their own tests to determine the safety and suitability of each product combination for their own purposes.
- 2. All data may change without prior notice, due to technical modifications or production changes.

Asia and Oceania: Toray Industries, Inc.

1-1, Nihonbashi muromachi 2-chome Chuo-ku, Tokyo 103-8666, Japan

Tel: +81 3 3245 4540 Fax: +81 3 3245 4913 http://www.toraywater.com

Americas: Toray Membrane USA, Inc.

13435 Danielson St, Poway, CA 92064, USA Tel: +1 858 218 2390

Fax: +1 858 486 3063

<u>Europe:</u> Toray Membrane Europe AG

Grabenackerstrasse 8 CH-4142 Münchenstein 1, Switzerland

Tel: +41 61 415 87 10 Fax: +41 61 415 87 20

Toray BlueStar Membrane Co., Ltd.

No.5 Anxiang Street, Area B, Beijing Tianzhu Airport Economic Development Zone, Beijing ,101318 P.R.C.

Tel: +86 10 80490552 Fax: +86 10 80485217

Middle East & North Africa: Toray Membrane Middle East LLC.

PO Box 20279, Al Khobar 31952, Kingdom of Saudi Arabia

Phone: +966-13-568-0091 Fax: +966-13-568-0093